


Book No. 4530

25¢

# GETTING THE MOST OUT OF YOUR DRILL PRESS

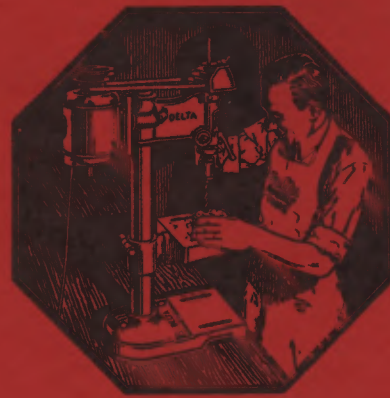


*Published by*  
**DELTA**

# GETTING THE MOST OUT OF YOUR DRILL PRESS

TWENTY-SECOND EDITION

A DELTA-CRAFT PUBLICATION

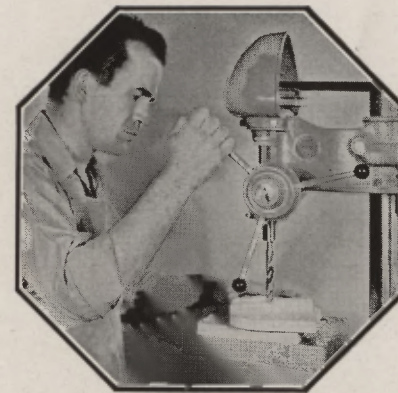

Edited by  
JAMES TATE

A Complete Manual Covering all Phases of Drill Press  
Operation in the Home Workshop with Over Two  
Hundred Photographic Illustrations and Line Drawings.

Copyright 1937



**DELTA POWER TOOL DIVISION**

Rockwell MANUFACTURING COMPANY

MILWAUKEE 1, WISCONSIN



# MAIN CONTENTS

## • GETTING THE MOST OUT OF YOUR DRILL PRESS

### CHAPTER ONE—THE DRILL PRESS.

Construction—Size—Power and Speed—Spindles—Inserting Spindle—Belt Tension—  
Inserting Drills—Centering Table—Adjusting Spindle Return Spring—Tilting Table..... 4-7

### CHAPTER TWO—LAYING OUT THE WORK.

Laying Out Necessary—The Combination Square—Hermaphrodite Calipers—Mark-  
ing—Examples of Layout—Laying Out Dowel Holes—Surface Gage—Punches..... 8-10

### CHAPTER THREE—WOOD BITS.

Names of Parts—Common Styles of Wood Bits—Screw and Brad Points—Condition-  
ing—Other Bit Styles—Plug Cutters—Mortising Bits and Chisels—Twist Drills for  
Wood—Sanding Drums—Grinding Wheels ..... 11-13

### CHAPTER FOUR—DRILLING PRACTICE IN WOOD.

Speed—Boring a Hole—Boring Holes at an Angle—Boring Holes to Depth—Bor-  
ing Holes in Series—Holes in Round Work—Use of Pivot Pin—Boring Deep Holes  
—Boring Large Holes—Drilling Screw Holes—Countersinking—Boring Mortises—  
Cutting Dowels—Boring Dowel Holes—Fitting Dowels ..... 14-19

### CHAPTER FIVE—TWIST DRILLS.

Twist Drills—Point Angle—Lip Clearance—How to Grind—Web Thinning—Drilling  
in Brass ..... 20-22

### CHAPTER SIX—DRILLING PRACTICE IN METAL.

Clamping Is Important—Stop Bolts—Strap Clamps—Parallels—Standard Fixtures—  
Guarding Against Spring—Mounting Work Vertical—Use of Vise—Use of Lathe  
Chuck—Other Job Set-ups—Drawing a Drill—Countersinking—Countersinking Plate  
—Drilling Round Stock—Drilling Large Holes—Drilling Very Small Holes—Drilling  
Sheet Metal—Drilling for Tapped Holes—Starting the Tap—Tap Styles—Tapping on  
the Drill Press ..... 23-28

### CHAPTER SEVEN—ROUTING ON THE DRILL PRESS.

Routing—Using Mortising Fence—Guard—Rotation and Feed—Use of Circular Saw  
Fence—Routing Curved Work—Rabbeting—Cross Routing—Using Small Router Bits  
—Routing with Pattern—Mortising—Fluting—Cutting Rosettes—Using Pivot Pin—  
Production Work ..... 29-32

### CHAPTER EIGHT—SHAPING ON THE DRILL PRESS.

Adaptability—Position of Head—Cutters—Methods of Working..... 33-34

### CHAPTER NINE—MORTISING ON THE DRILL PRESS.

Conversion—Inserting Chisel—Cutting the Mortise—Variations..... 35-36

### CHAPTER TEN—MISCELLANEOUS DRILL PRESS OPERATIONS.

Drilling Glass—Drilling Slate and Marble—Drilling Paper—Drilling Plastics—Milling  
—Cutting and Fitting Plugs—Carving—Surfacing—Sanding—Sanding with Pattern..... 37-40

### CHAPTER ELEVEN—USEFUL IDEAS.

Spinning Rivets—Making Flat Drills—Fluting Turned Work—Boring Jigs—Cutting  
Disks—Cutting Tenons—Circle Jig—Mixing Paint—Engine Finish—Pointing Dowel  
Rod—Using Drill Press as Vise—Sanding Table Legs—Tapering Dowels—Polishing..... 41-44

### APPENDIX

Decimal Equivalents—Number-size Drills—Letter-size Drills—Drill Sizes for Machine  
and Wood Screws—Standard Drill Press Operating Speeds—Drill Lubricants—Glass  
Table—Board Measure—Drill Speeds ..... 45-48

# MAIN CONTENTS

## • GETTING THE MOST OUT OF YOUR DRILL PRESS

### CHAPTER ONE—THE DRILL PRESS.

Construction—Size—Power and Speed—Spindles—Inserting Spindle—Belt Tension—  
Inserting Drills—Centering Table—Adjusting Spindle Return Spring—Tilting Table..... 4-7

### CHAPTER TWO—LAYING OUT THE WORK.

Laying Out Necessary—The Combination Square—Hermaphrodite Calipers—Mark-  
ing—Examples of Layout—Laying Out Dowel Holes—Surface Gage—Punches..... 8-10

### CHAPTER THREE—WOOD BITS.

Names of Parts—Common Styles of Wood Bits—Screw and Brad Points—Condition-  
ing—Other Bit Styles—Plug Cutters—Mortising Bits and Chisels—Twist Drills for  
Wood—Sanding Drums—Grinding Wheels ..... 11-13

### CHAPTER FOUR—DRILLING PRACTICE IN WOOD.

Speed—Boring a Hole—Boring Holes at an Angle—Boring Holes to Depth—Bor-  
ing Holes in Series—Holes in Round Work—Use of Pivot Pin—Boring Deep Holes  
—Boring Large Holes—Drilling Screw Holes—Countersinking—Boring Mortises—  
Cutting Dowels—Boring Dowel Holes—Fitting Dowels ..... 14-19

### CHAPTER FIVE—TWIST DRILLS.

Twist Drills—Point Angle—Lip Clearance—How to Grind—Web Thinning—Drilling  
in Brass ..... 20-22

### CHAPTER SIX—DRILLING PRACTICE IN METAL.

Clamping Is Important—Stop Bolts—Strap Clamps—Parallels—Standard Fixtures—  
Guarding Against Spring—Mounting Work Vertical—Use of Vise—Use of Lath  
Chuck—Other Job Set-ups—Drawing a Drill—Countersinking—Countersinking Plate  
—Drilling Round Stock—Drilling Large Holes—Drilling Very Small Holes—Drilling  
Sheet Metal—Drilling for Tapped Holes—Starting the Tap—Tap Styles—Tapping on  
the Drill Press ..... 23-28

### CHAPTER SEVEN—ROUTING ON THE DRILL PRESS.

Routing—Using Mortising Fence—Guard—Rotation and Feed—Use of Circular Saw  
Fence—Routing Curved Work—Rabbeting—Cross Routing—Using Small Router Bits  
—Routing with Pattern—Mortising—Fluting—Cutting Rosettes—Using Pivot Pin—  
Production Work ..... 29-32

### CHAPTER EIGHT—SHAPING ON THE DRILL PRESS.

Adaptability—Position of Head—Cutters—Methods of Working..... 33-34

### CHAPTER NINE—MORTISING ON THE DRILL PRESS.

Conversion—Inserting Chisel—Cutting the Mortise—Variations..... 35-36

### CHAPTER TEN—MISCELLANEOUS DRILL PRESS OPERATIONS.

Drilling Glass—Drilling Slate and Marble—Drilling Paper—Drilling Plastics—Milling  
—Cutting and Fitting Plugs—Carving—Surfacing—Sanding—Sanding with Pattern..... 37-40

### CHAPTER ELEVEN—USEFUL IDEAS.

Spinning Rivets—Making Flat Drills—Fluting Turned Work—Boring Jigs—Cutting  
Dieks—Cutting Tenons—Circle Jig—Mixing Paint—Engine Finish—Pointing Dowel  
Rod—Using Drill Press as Vise—Sanding Table Legs—Tapering Dowels—Polishing..... 41-44

### APPENDIX

Decimal Equivalent—Number-size Drills—Letter-size Drills—Drill Sizes for Machine  
and Wood Screws—Standard Drill Press Operating Speeds—Drill Lubricants—Glass  
Table—Board Measure—Drill Speeds ..... 45-48